

Subject: Tire to Fender Interference - 1967 Model GT350 and GT500 Vehicles

Reports from some purchasers indicate that under some driving conditions an interference can exist between the front tires and the fenders and/or front fender wheel opening mouldings, in conjunction with the Goodyear E-70 Wide Oval Tires, standard equipment on all 1967 model GT350 and GT500 vehicles.

Customers who report tire to fender interference may have their front fenders reworked under warranty. Labor Allowance is 0.8 hours.

REWORK PROCEDURE

Bend the front fender flange until the inside raw edge of metal is 0.5 inches from the normal sheet metal surface. Rework is required from the centerline of wheel opening to a distance of 7 inches forward and 7 inches rearward.

Harry Neumann
Service and Warranty Administrator

